09V-116 (3 Pages)

April 8, 2009

Mr. Daniel C. Smith
Associate Administrator for Enforcement
National Highway Traffic Safety Administration
Recall Management Division (NVS-215)
1200 New Jersey Avenue, SE – Room W45-306
Washington, D.C. 20590

TOGINGD

TO AR -8 P 12: 15

To a second seco

Dear Mr. Smith:

The following information is submitted pursuant to the requirements of 49 CFR 573.6 as it applies to a determination by General Motors of a safety defect involving certain 1997-2003 Buick Regal, 1998-1999 Chevrolet Lumina, 1998-2003 Chevrolet Monte Carlo, 2000-2003 Chevrolet Impala, 1998-1999 Oldsmobile Intrigue and 1997-2003 Pontiac Grand Prix vehicles equipped with 3.8L V6 Naturally Aspirated Engine (RPO L36 – VIN K).

573.6(c)(1): Buick, Chevrolet, Oldsmobile and Pontiac Brands of General Motors Corporation

573.6(c)(2)(3)(4): This information is shown on the attached sheet.

573.6(c)(5): General Motors has decided that a defect, which relates to motor vehicle safety, exists in certain 1997-2003 model year Buick Regal and Pontiac Grand Prix, 1998-1999 model year Chevrolet Lumina and Oldsmobile Intrigue, 1998-2003 model year Chevrolet Monte Carlo, and 2000-2003 model year Chevrolet Impala model vehicles, equipped with a 3.8L V6 naturally aspirated engine (RPO L36 – VIN K). Some of these vehicles have a condition in which drops of engine oil may be deposited on the exhaust manifold through hard braking. If the manifold is hot enough and the oil runs below the heat shield, in rare instances, it may ignite into a small flame and may spread to the plastic spark plug wire channel and beyond.

573.6(c)(6): In April 2008, GM released a recall in response to an Engineering Analysis (EA07-008). In comparison, the rate of underhood fires in the L36 vehicles was significantly lower than L67 vehicles. At that time, test results also indicated that the L36 rocker cover gaskets experienced significantly lower temperatures, and therefore would have a longer life, than the L67 gaskets. In comparison, the L36 rocker cover warranty rates for gasket leaks was 1/6 the rate of the L67 at 6 years of exposure.

In July 2008, GM reviewed TREAD Data for underhood fires on L36-W cars

On October 14, 2008, GM reviewed claims for underhood fires on L36-W cars.

On November 1, 2008, a Product Investigation Engineer was assigned to evaluate the condition.

On January 21, 2009, GM updated the July summary of TREAD Data for underhood fires on L36-W cars.

In February and March 2009, GM continued its investigation.

The issue was presented to the Field Performance Evaluation Review Committee and on April 7, 2009, the Executive Field Action Decision Committee decided to conduct a safety recall.

<u>573.6(c)(8)</u>: Dealers are to remove the spark plug wire retention channel at the front of engine and install two new spark plug wire retainers.

Pursuant to 577.11(e), reimbursement to owners does not apply because the remedy was not available prior to this recall.

Letter to Mr. Daniel C. Smith N090047 April 8, 2009 Page 2

573.6(c)(9): The dealer bulletin and owner letter will be provided when available. It is anticipated that the dealer bulletin and owner letters will be sent May 2009.

Surcerely,

Pay P. Kent Director

Product Investigations

N090047 Attachment

VEHICLES POTENTIALLY AFFECTED BY MAKE, MODEL, AND MODEL YEAR
PLUS INCLUSIVE DATES OF MANUFACTURE

	Pontiac Pontiac	Pontiac	Pontiac	Pontiac	Pontiac	Pontiac	Oldsmobile	Oldsmobile		Chevrolet	Chevrolet	Chevrolet	Chevrolet	Chevrolet	Chevrolet	Chevrolet	Chevrolet	Chevrolet	Chevrolet	Chevrolet	Chevrolet	BUICK		D in K	Buick	Buick	Buick	Buick	Buick	MAKE
GM Total:	€ €	€ ₹	€ ≥	€	\$	\$	8	8		≶	≶	≨	8	\$	\$	\$	\$	\$	€	\$	\$	8	{	٤	€	≶	€	8	8	MODEL SERIES
	2003	7007	2000	1999	1998	1997	666L	1998	!	2003	2002	2001	2000	2003	2002	2001	2000	1999	1998	1999	1998	2003	200	2002	2001	2000	1999	1998	1997	MODEL YEAR
1,497,516	27,807	67,825	90,334	85,6/4	70,128	107,944	37,065	98,798	1	93.117	83,263	84,468	99,551	37,983	38,970	37,689	30,078	15,352	19,702	15,890	19,796	32,000	33,788	33,459	44,968	49,436	54,793	4/,3//	12,847	NUMBER INVOLVED
	05/2002	03/2000	04/1999	03/1998	03/1997	03/1996	04/1996	11/1996		03/2002	03/2001	05/2000	11/1998	03/2002	03/2001	05/2000	11/1998	03/1998	05/1997	03/1998	05/1997	2002/40	04/2003	03/2001	05/2000	03/1999	03/1998	04/199/	08/1996	INCLUSIVE MANUFACTURING (FROM)
	02/2003	06/2001	06/2000	6662/20	8661/80	06/1997	6661 70	08/1998		06/2003	06/2002	06/2001	06/2000	06/2003	06/2002	06/2001	06/2000	05/1999	8661/80	05/1999	08/1998	0012000	06/2003	06/2002	06/2001	06/2000	07/1999	9661/80	07/1997	VG DATES
	Grand Prix	Grand Prix		and	ano	Grand Prix	mugue	Intrigue		lmpala	Impala	Impala	Impala	Monte Carlo	Monte Cano	Lumina	Lumina		Regal	Regal	Regal	Regal	Regai	Xegai	Regal	DESCRIPTIVE INFO. TO PROPERLY IDENT. VEH.				
	F	F	a	r	=	F #		F #					R J	: ;	F .	E 1	E !	E 1	•	e :	£ E		r	•	=	: :		•	.	EST. NO. W/CONDITION

^{*} All involved vehicles will be corrected as necessary.